


MOUNTING INSTRUCTIONS: STANDARD EUROPEAN MOUNT


1 - SCREW THE RAIL on the rifle, paying attention at the correct orientation (caption **FRONT** towards the barrel)

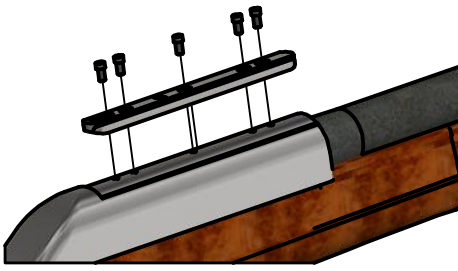


ATTENTION: for the correct tightening use the threadlocker with **MAX force 3 Nm**.

- it is advisable to use medium threadlocker

2 - SCREW THE RINGS on the mount without locking the screws.

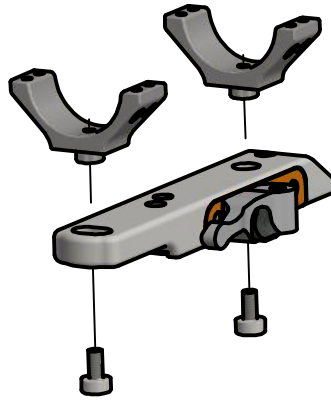


3 - LOCK THE RINGS lock the rings using a scope or a ground cylinder to ensure the perfect lineup of the rings

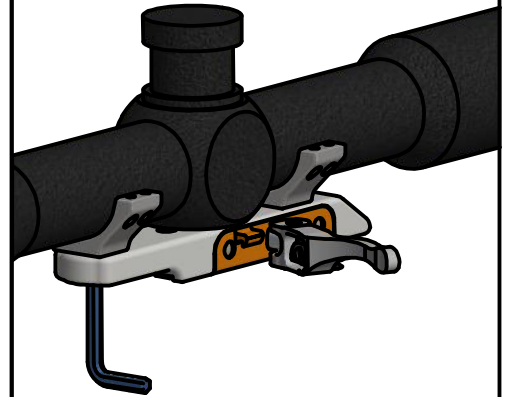


4 - ASSEMBLY OF THE MOUNT

- Open the lever of the mount
- Put the mount on the rail inserting the recoil stop into one of the specific slots

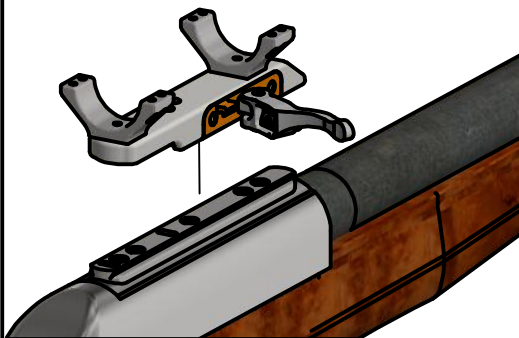


5 - CLOSE THE LEVER

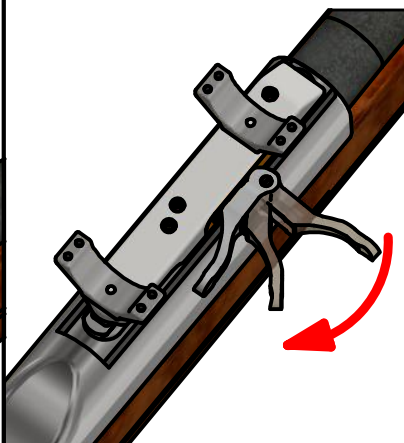



6 - Position the scope, SCREW THE TOP RINGS with the provided screws at their specific bases

ATTENTION: for the correct tightening use the threadlocker with **MAX force 2 Nm**.

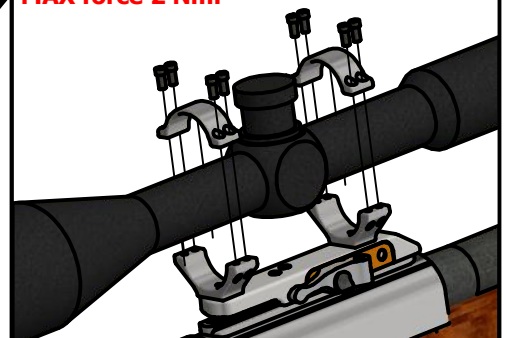

ATTENTION

- Make a parallel tightening of the upper rings, to guarantee a correct and efficient locking of the scope
- The tightening of the screws must be done in cross mode, in this way it guarantees an efficient locking of the scope
- Make sure that the Torx keys are fully inserted into the seats when tightening

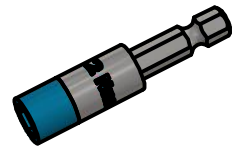
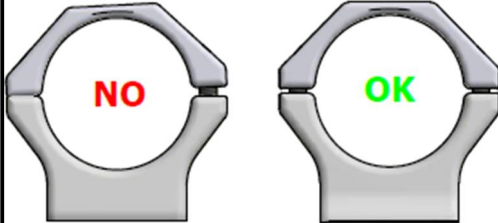


On request can be give a torque wrench at 2 nm apposite for lend attention at every tightening

EXCLUSIVELY IN CASE OF NEED

ADJUST THE TIGHTENING STRENGTH OF THE LEVER

- carefully loosen the inclined fixing grub screw using a 2.5 mm hexagonal wrench.
 - tighten the side screw to the grub screw at a force of 1.8 - 2 Nm with a 4 mm wrench.
 - carefully tighten the inclined fixing grub screw using a 2.5 mm hexagonal wrench.
- make sure that the Allen keys are fully inserted into the hexagonal seats when tightening

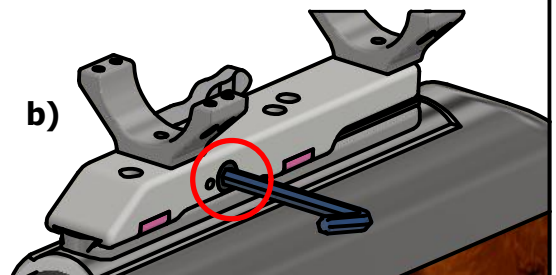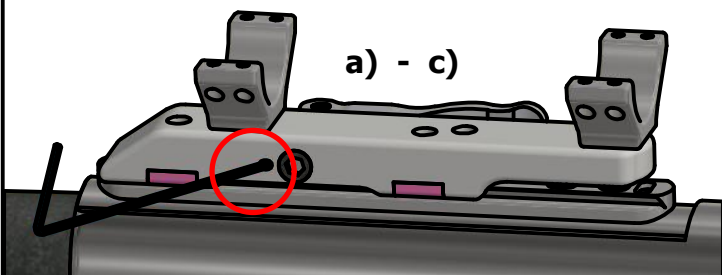

THE MANUFACTURER IS RELIEVED FROM ANY LIABILITY FOR USE NOT IN CONFORMITY WITH THE PRODUCT ASSEMBLY INSTRUCTIONS, FOR TAMPERING, FOR INCORRECT ASSEMBLIES, MODIFICATIONS AND REPLACEMENTS NOT PERFORMED BY THE COMPANY'S STAFF. IMPROPER USE OF THE PRODUCT IS FORBIDDEN